


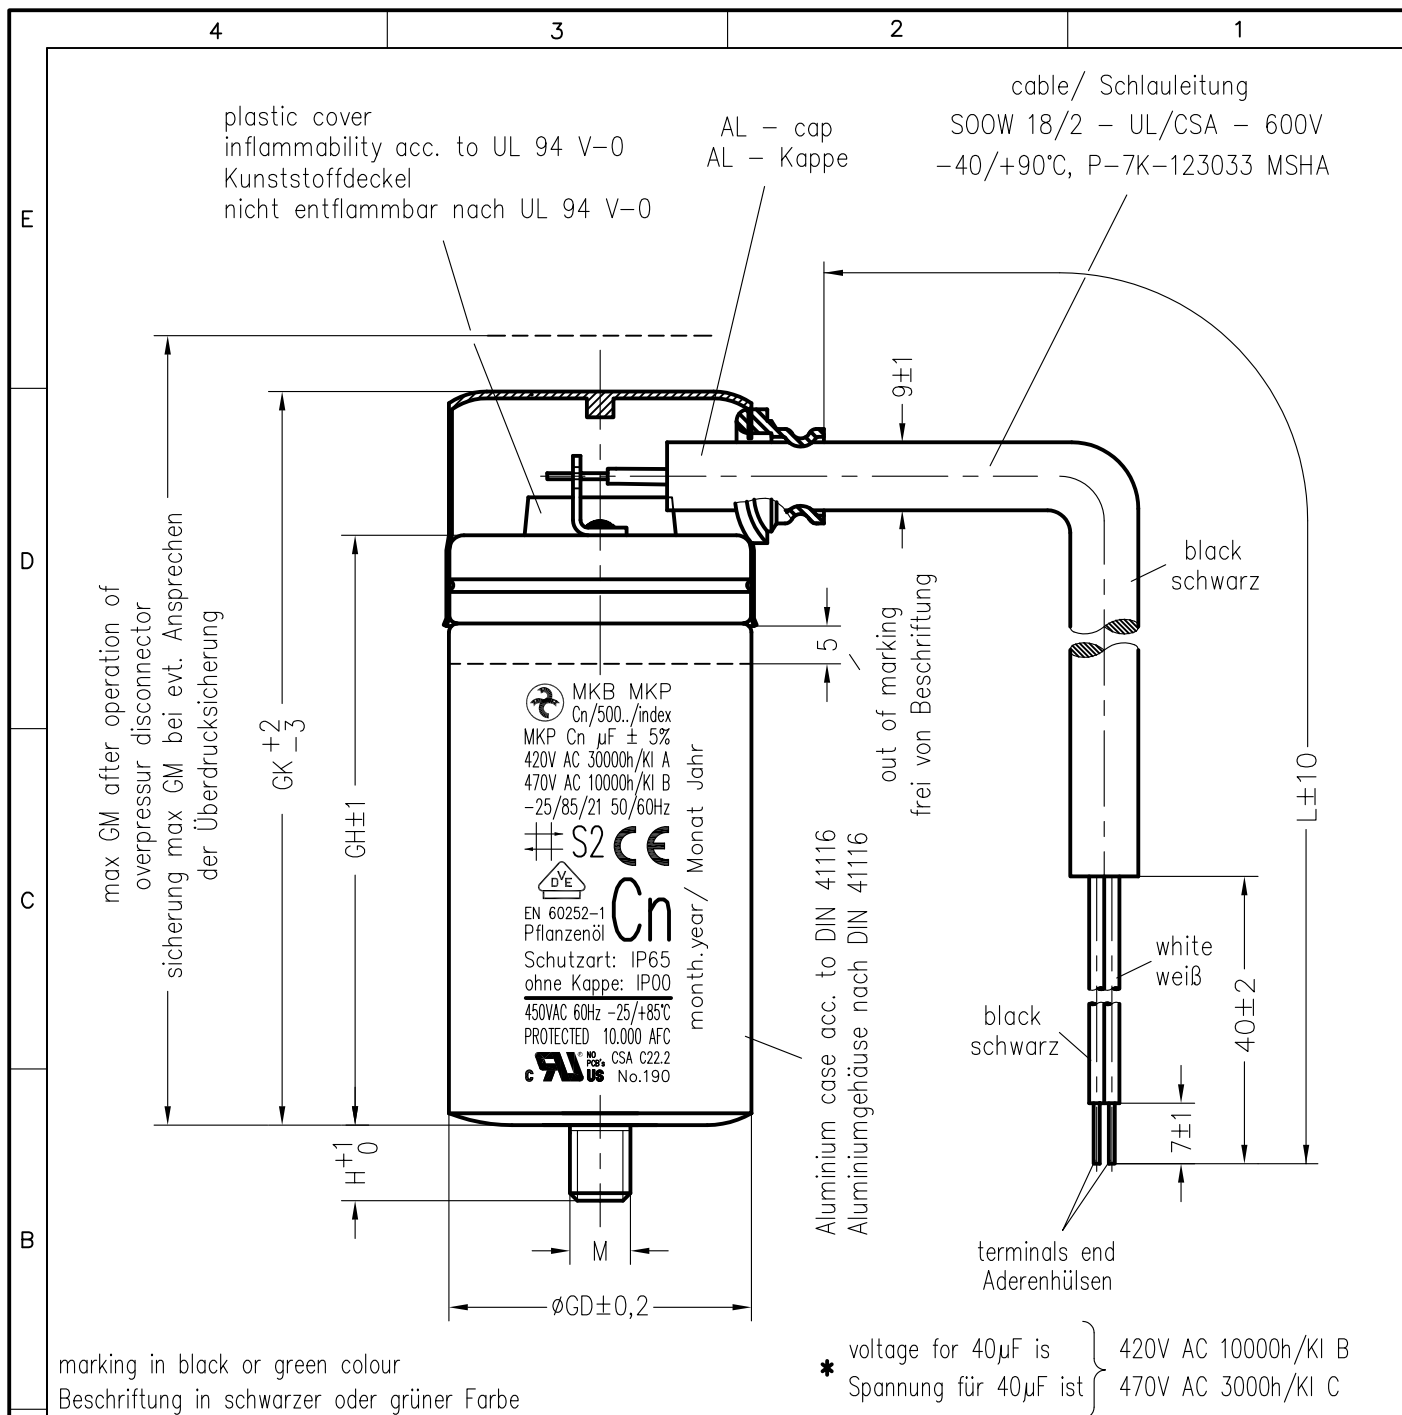

A	Hanning Nr.	Cn	Description	GD	GH	GK	GM	M	H	L
	42 468	3	MKB MKP 3/500I/1218	30	48	72	82	M8	10	300
	42 741	5	MKB MKP 5/500II/1856	30	58	85	92	M8	10	350
	42 627	6	MKB MKP 6/500II/1219	30	58	85	92	M8	10	250
	42 418	8	MKB MKP 8/500/1218	30	78	105	112	M8	10	300
	42 431	16	MKB MKP 16/500I/1218	40	78	100	107	M8	10	300
	42 432	25	MKB MKP 25/500/1218	40	98	125	132	M8	10	300
	42 494	40 *	MKB MKP 40/500I/1218	55	103	122	131	M12	12	300
Storage conditions for Hydra capacitors see instruction 464.073 909.FA appendix 10.			Freimasstoleranzen		Oberflaechen		Masstab: %			C:\SET\AutoCAD vykresy\SET_KK\TD\150297td.dwg
							Werkstoff:			
					2005	Datum	Name		MKB-SI-Motorkondensator MKB MKP Cn/500../Index	
					Bearb.	10.MÄR.	MChrtk			
					Gepr.					
					Norm.					
04	0075/16	27.04.	Chr						464.150 297.TD	
03	0064/14	23.07.	Chr							
02	0012/13	22.01.	Chr							
01	0116/05	25.04.	Chr							
Zust.	Aenderung	Datum	Name	Norm.	Urspr.:		Ers. f.:		Ers. d.:	
					 HYDRA				Blatt	
									Bl.	